1	91	IN	1.	ı.	2	_(M	11
		··		-u	_		,,	, ,

Knocktopher to Ballyhale Footpath Scheme

ROAD SAFETY AUDIT STAGE 1

December 2019

Ray Butler Consultant 087 261 6252 raybut51@gmail.com

1. INTRODUCTION

- 1.1 This report describes a Stage 1 Road Safety Audit carried out at Knocktopher Footpath Scheme on behalf of Kilkenny County Council.
- 1.2 The audit team members were as follows:-

Ray Butler, BE CEng MIEI;

Richard Frisby, BSc AEng MIEI;

- 1.3 Both audit team members visited the site. The audit comprised an examination of the drawings relating to the scheme supplied by Kilkenny County Council and an examination of the site.
- 1.4 This Stage 1 Audit has been carried out in accordance with the relevant sections of TII GE-STY-01024. The team has examined only those issues within the design relating to the road safety implications of the road access to the scheme, and has therefore not examined or verified the compliance of the design to any other criteria.
- 1.5 All of the problems described in this report are considered by the audit team to require action in order to improve the safety of the scheme and minimise accident occurrence.
- 1.6 Appendix A describes the audited drawings.

19101-02-001 December 2019 1

2. STAGE 1 AUDIT

2.1 **Problem**

The tactile paving at the school entrance appears to be directing pedestrians towards the carriageway. Visually impaired pedestrians may end up on the carriageway putting them at risk of collision with motor vehicles.

Recommendation

Direct pedestrians in the direction of the crossing.

2.2 Problem

Visually impaired pedestrians who are crossing at the south side of the school entrance may be directed into the grass verge. Pedestrians may lose their footing if they step into the grass verge when they expect to be on a solid footpath surface resulting in possible injury.

Recommendation

Direct pedestrians onto the footpath.

2.3 **Problem**

There are two locations where public lighting columns are located where the footpath is 1.5m or less wide, chainage 388 and chainage 510. If these poles are not located correctly at construction stage, they may impede pedestrians.

Recommendation

Move the column to opposite side of road if possible. If not possible ensure the column is erected as close as possible to the footpath boundary.

2.4 Problem

The existing chevron signs at chainage 545 are misleading to drivers and are not necessary in a 60 km/h speed limit zone.



Recommendation

Remove chevron signs and erect the existing advance direction signs on new poles

2.5 **Problem**

The existing public lighting column at chainage 694 appears to be leaning towards the road and may be at risk of falling putting pedestrians and drivers at risk of injury.



Recommendation

Replace this lighting column with a new column.

2.6 **Problem**

There is a junction warning sign at approximately chainage 710. It is not clear whether this sign will be in the footpath, where it may be an obstruction to pedestrians, or be moved to the back of the footpath.



Recommendation

Move the sign to the back of the footpath if necessary.

2.7 **Problem**

The tactile paving on the junction splitter island does not appear to line up with the tactile paving on the footpaths. Visually impaired pedestrians will be at risk of injury if they are not directed correctly.

Recommendation

Position the tactile paving to direct visually impaired pedestrians towards the footpaths.

2.8 **Problem**

The new footpath continues north along the edge of the R448 where there is no continuity of footpath facilities or hard shoulder. This may put pedestrians who use this footpath, particularly the visually impaired, at risk of injury if they step onto the road into the path of an approaching vehicle.

Recommendation

Finish the footpath at the junction crossing.

3. AUDIT TEAM STATEMENT

3.1 We certify that we have examined the road in operation. This examination has been carried out with the sole purpose of identifying any features of the scheme that could be removed or modified to improve the safety of the scheme.

Signed...... Ray Butler

Date 29th November 2019......

Signed...... Richard Frisby

Date29th November 2019.....

19101-02-001 December 2019 5


APPENDIX A


List of Drawings Examined:


Drawing numbered 19101-01-0001 and entitled 'Site Location Map' provided electronically in PDF format by Roadplan Consulting.

Drawing numbered 19101-01-0002 and entitled 'Proposed Site Layout (sheet 1 of 2)' provided electronically in PDF format by Roadplan Consulting.


Drawing numbered 19101-01-0003 and entitled 'Proposed Site Layout (sheet 2 of 2)' provided electronically in PDF format by Roadplan Consulting.

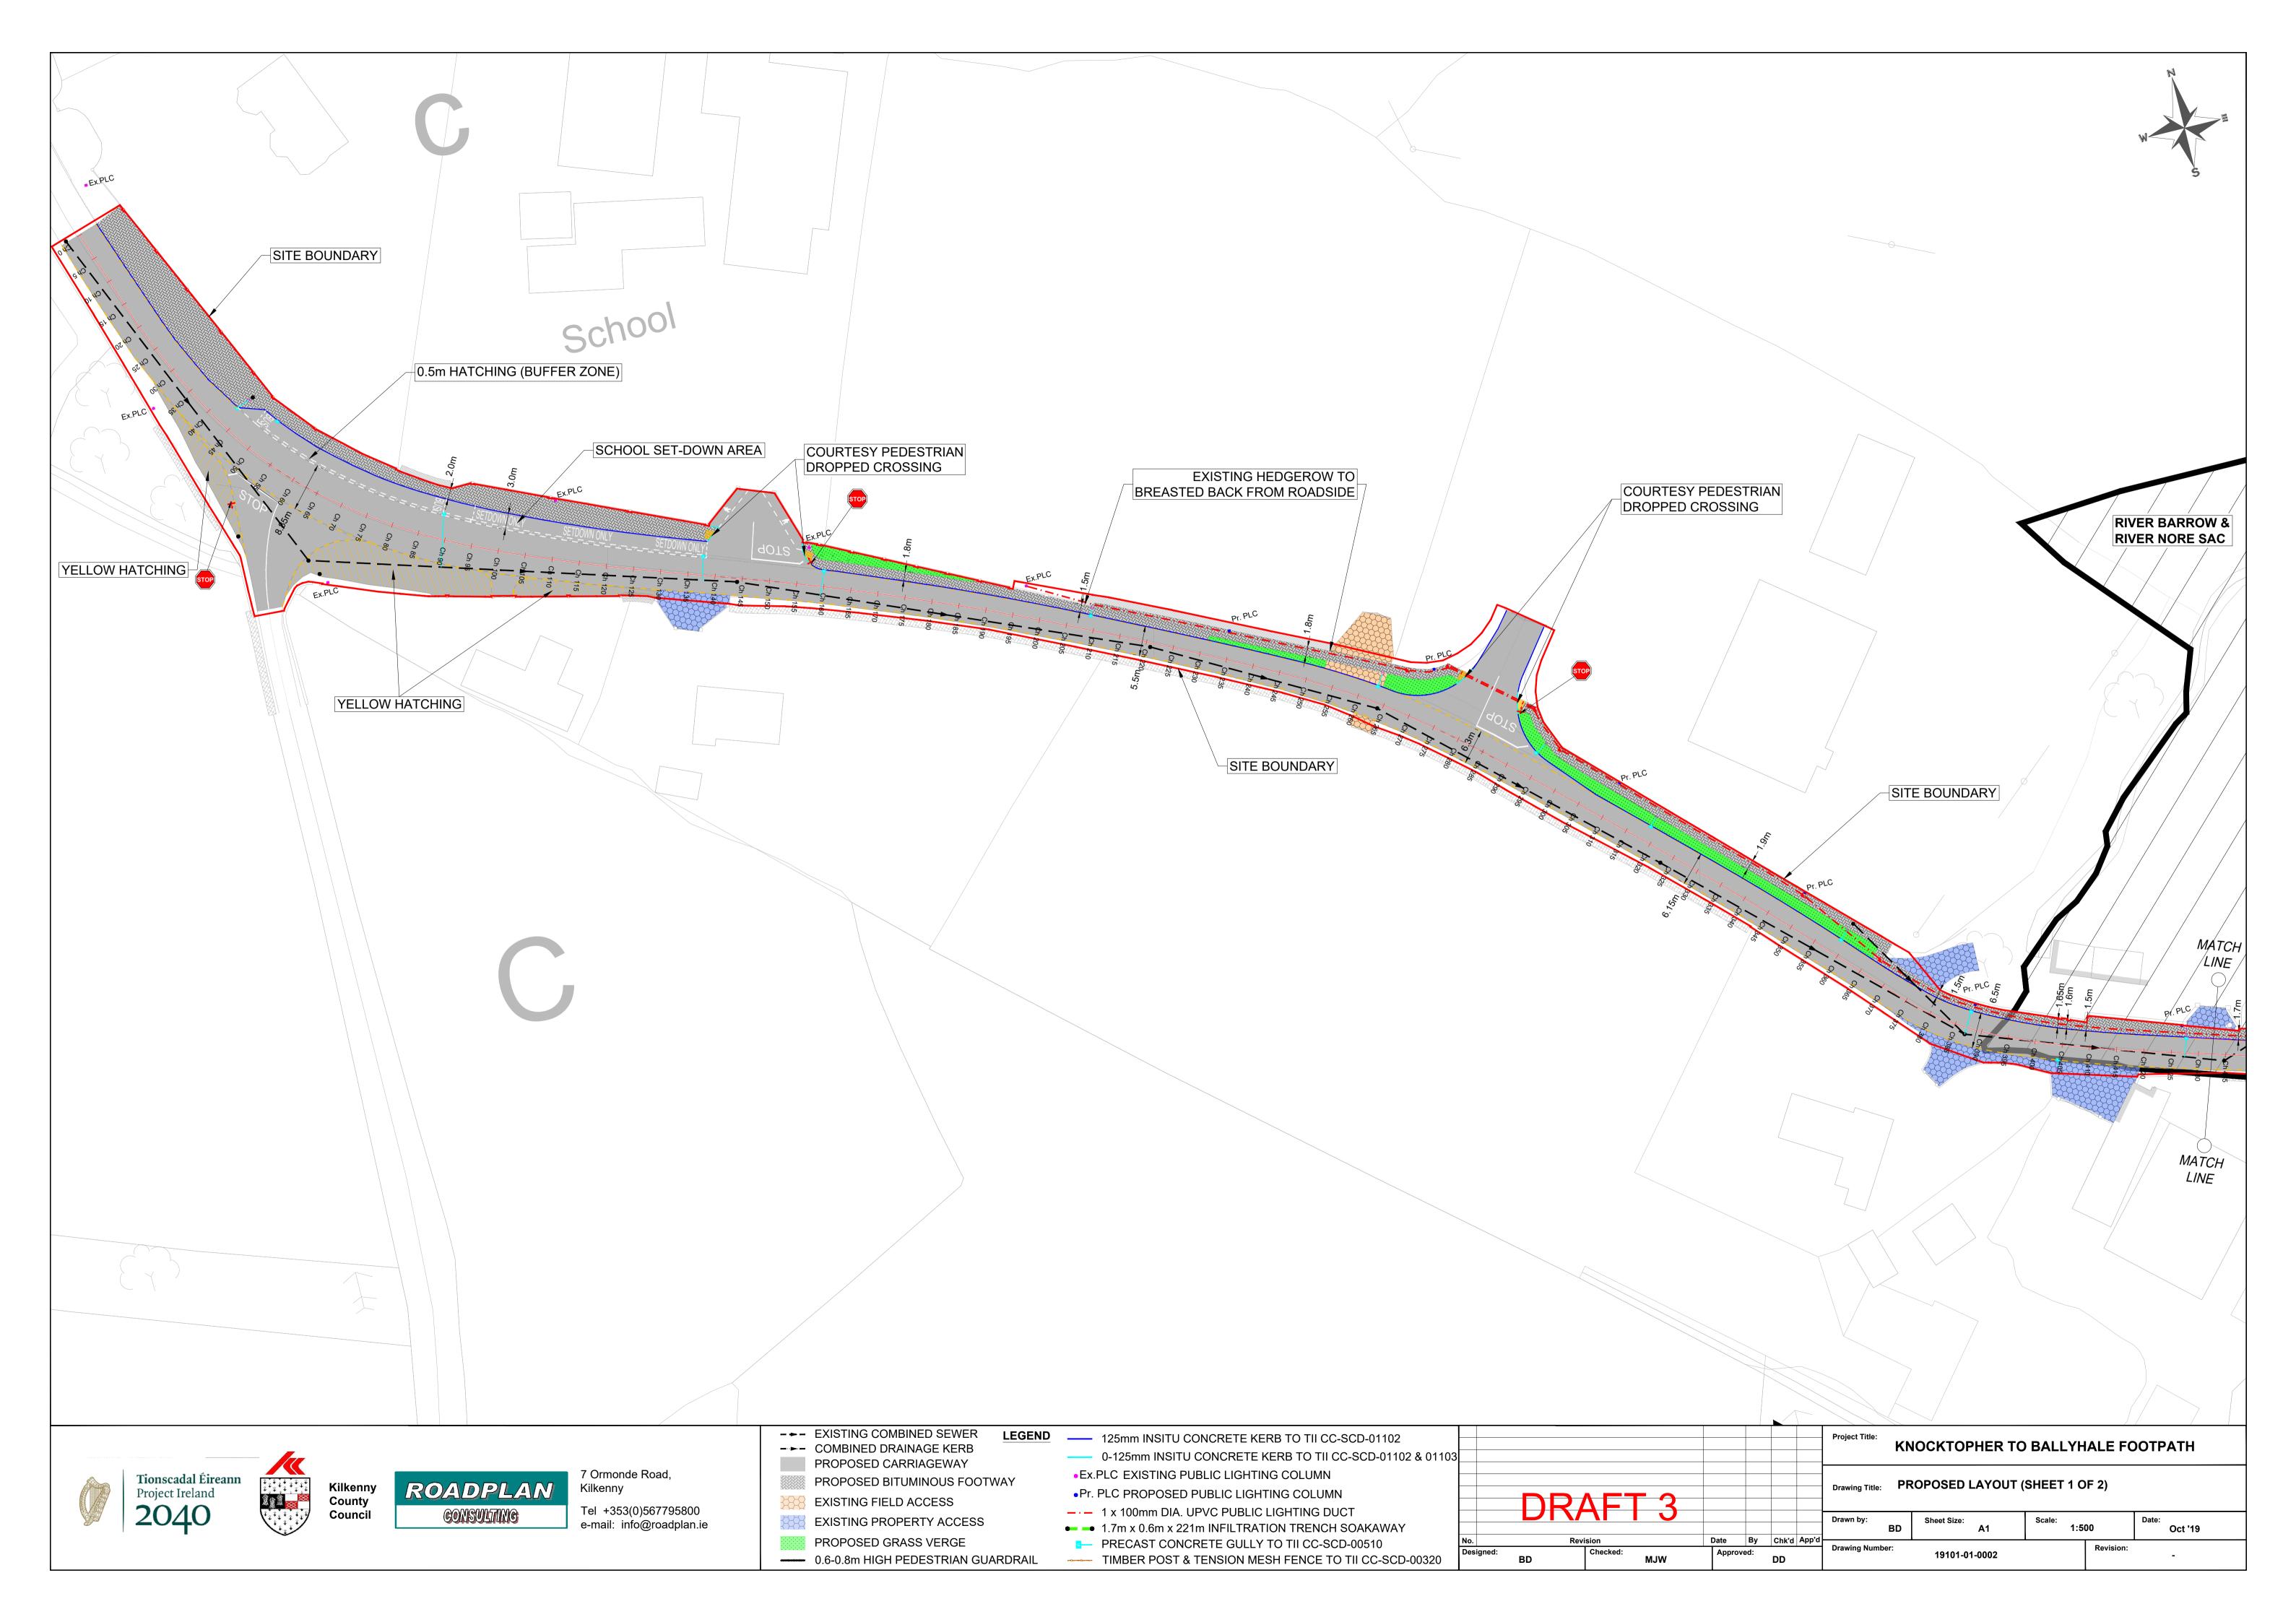

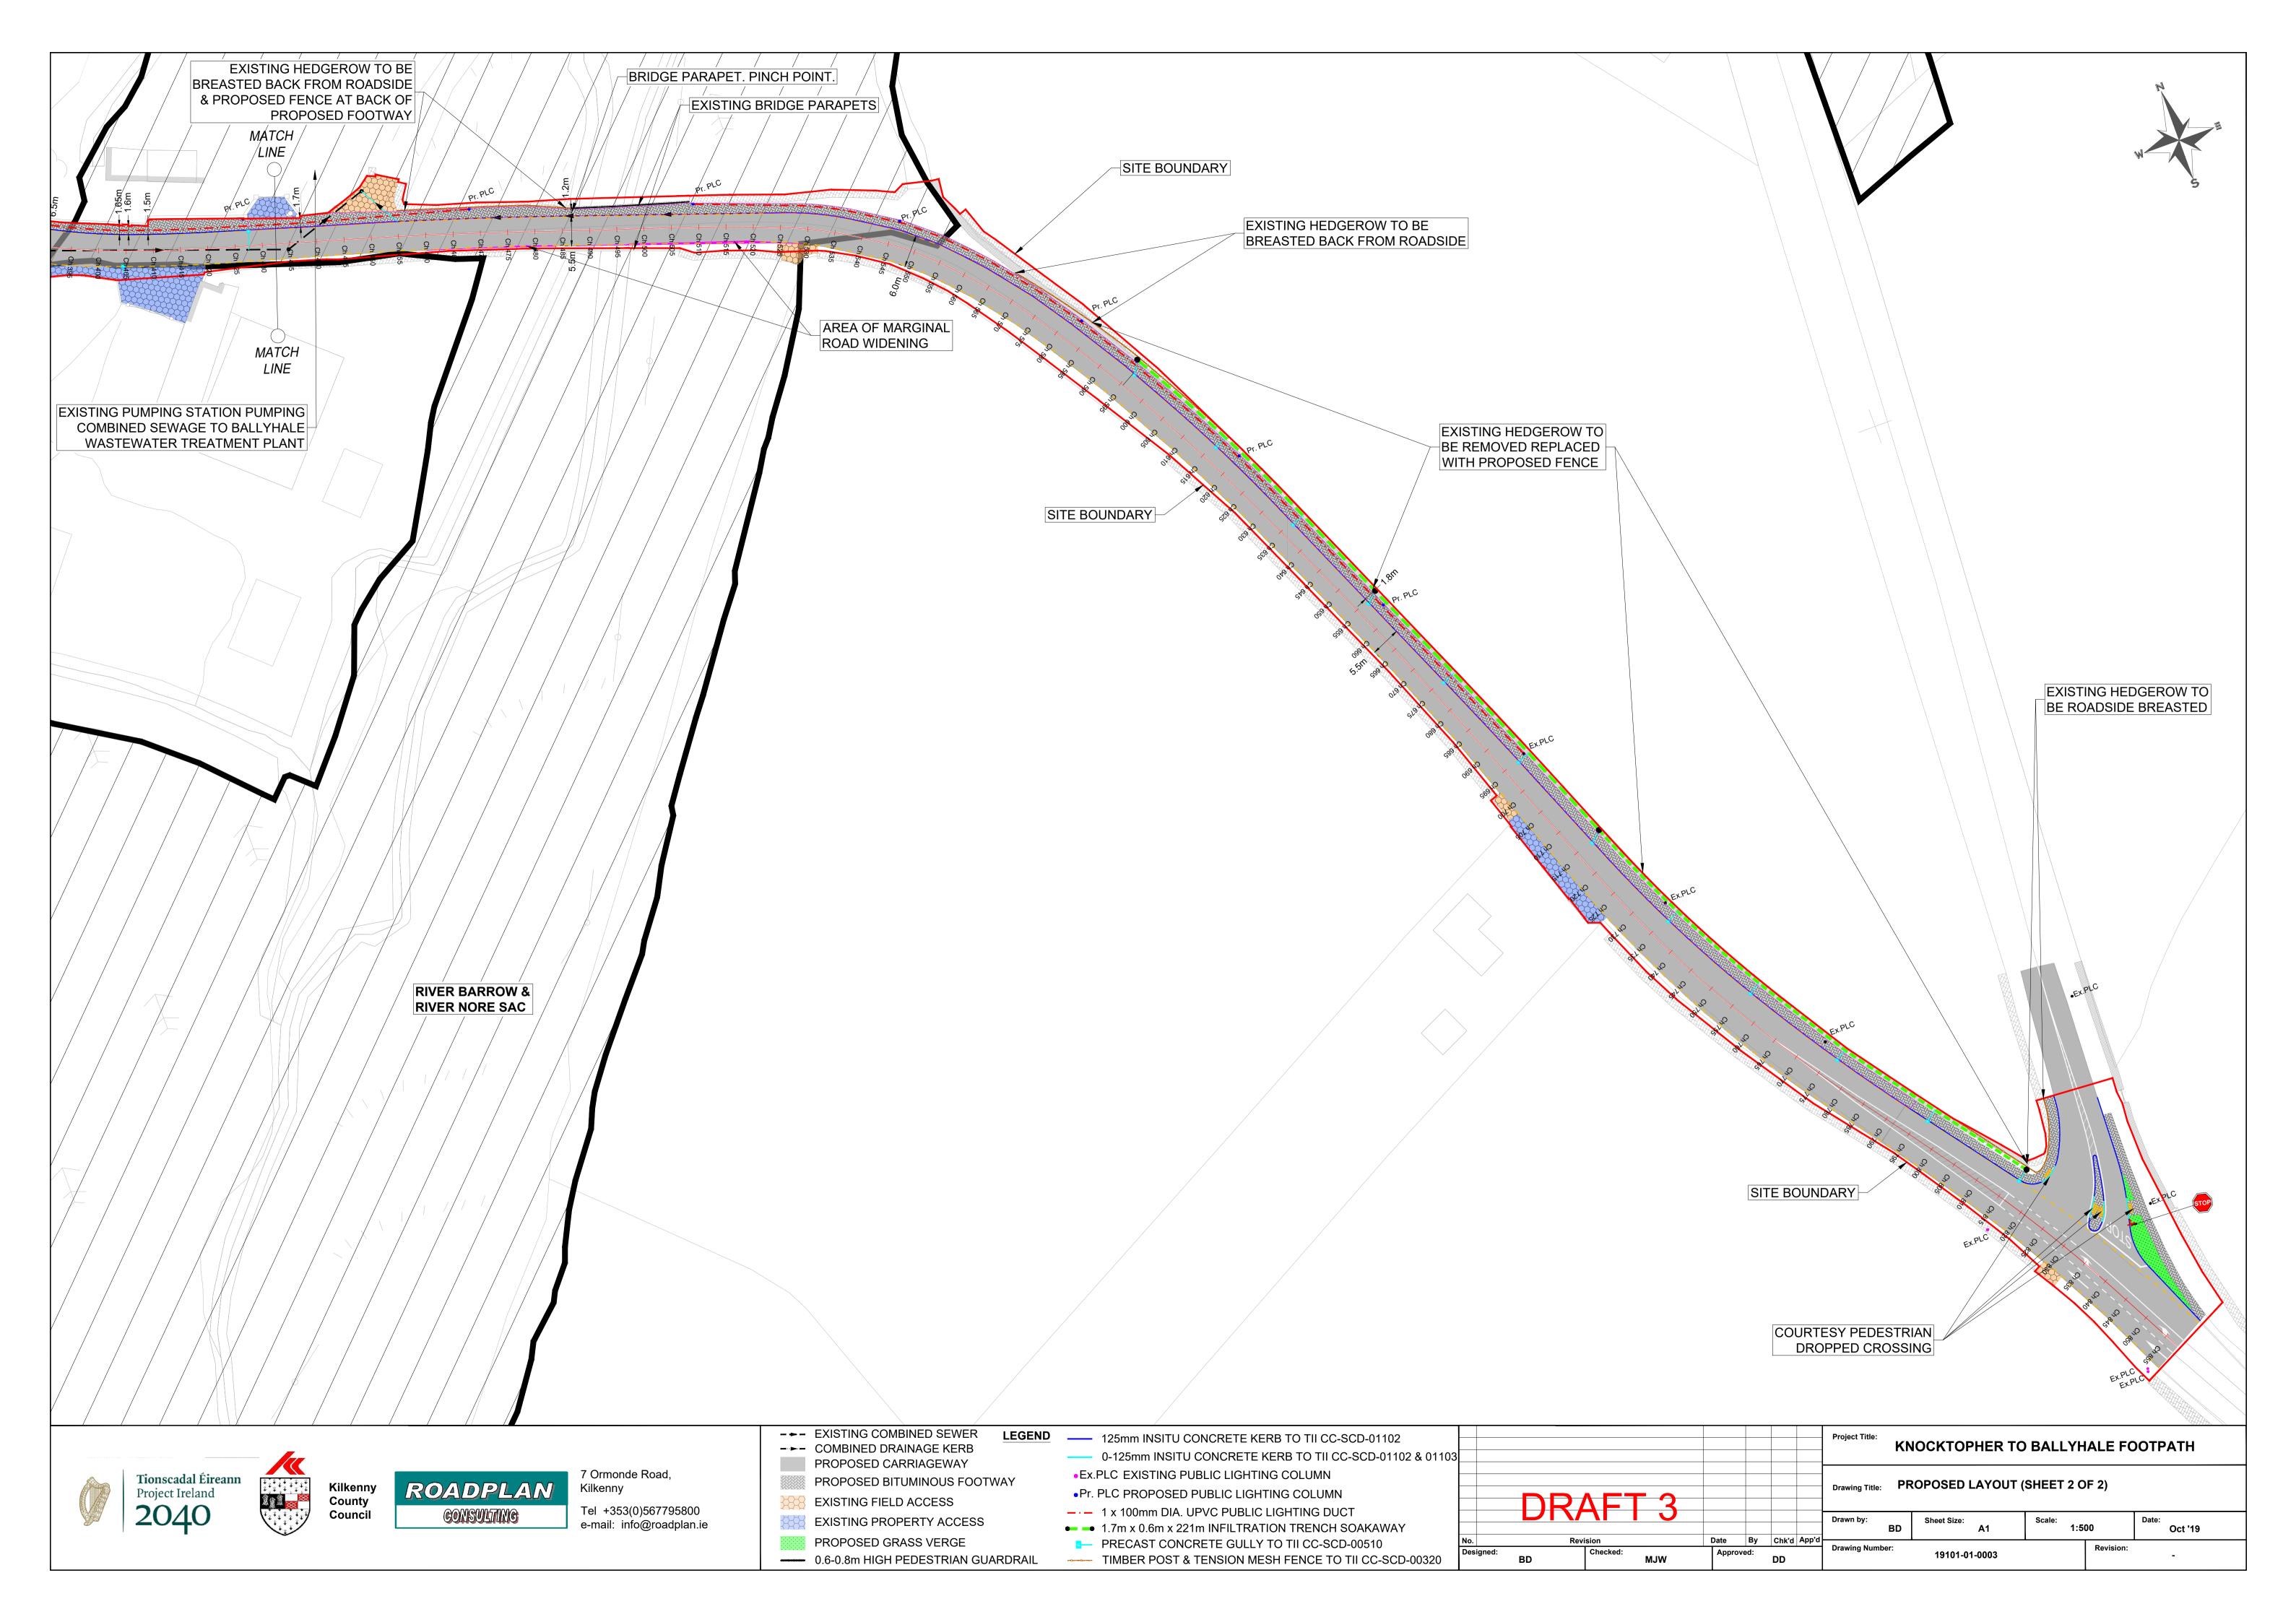

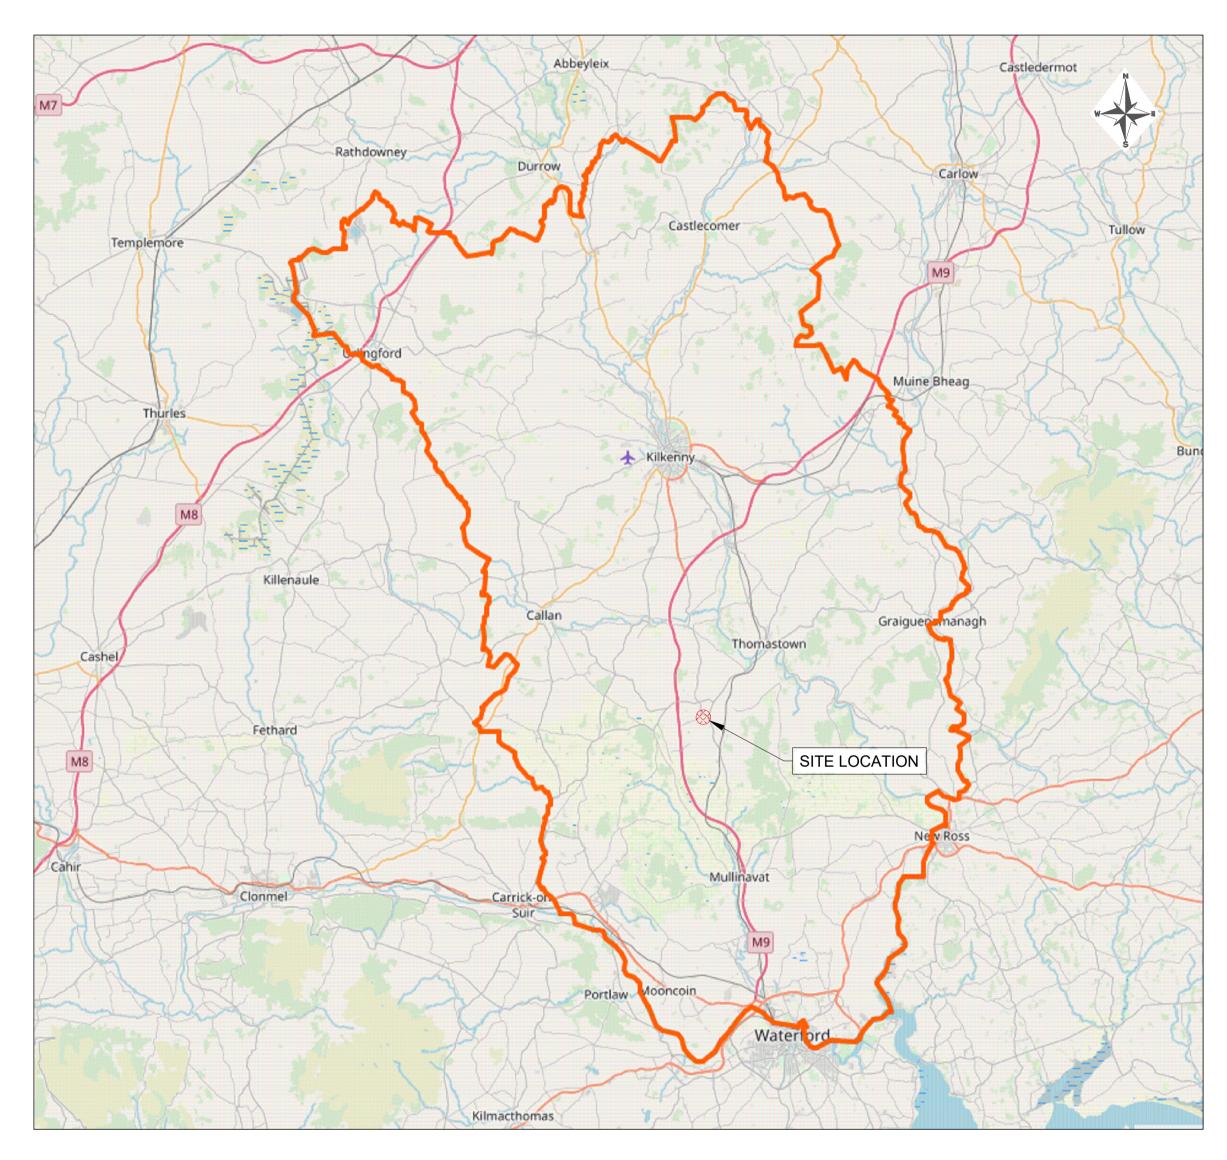

SITE LOCATION NTS

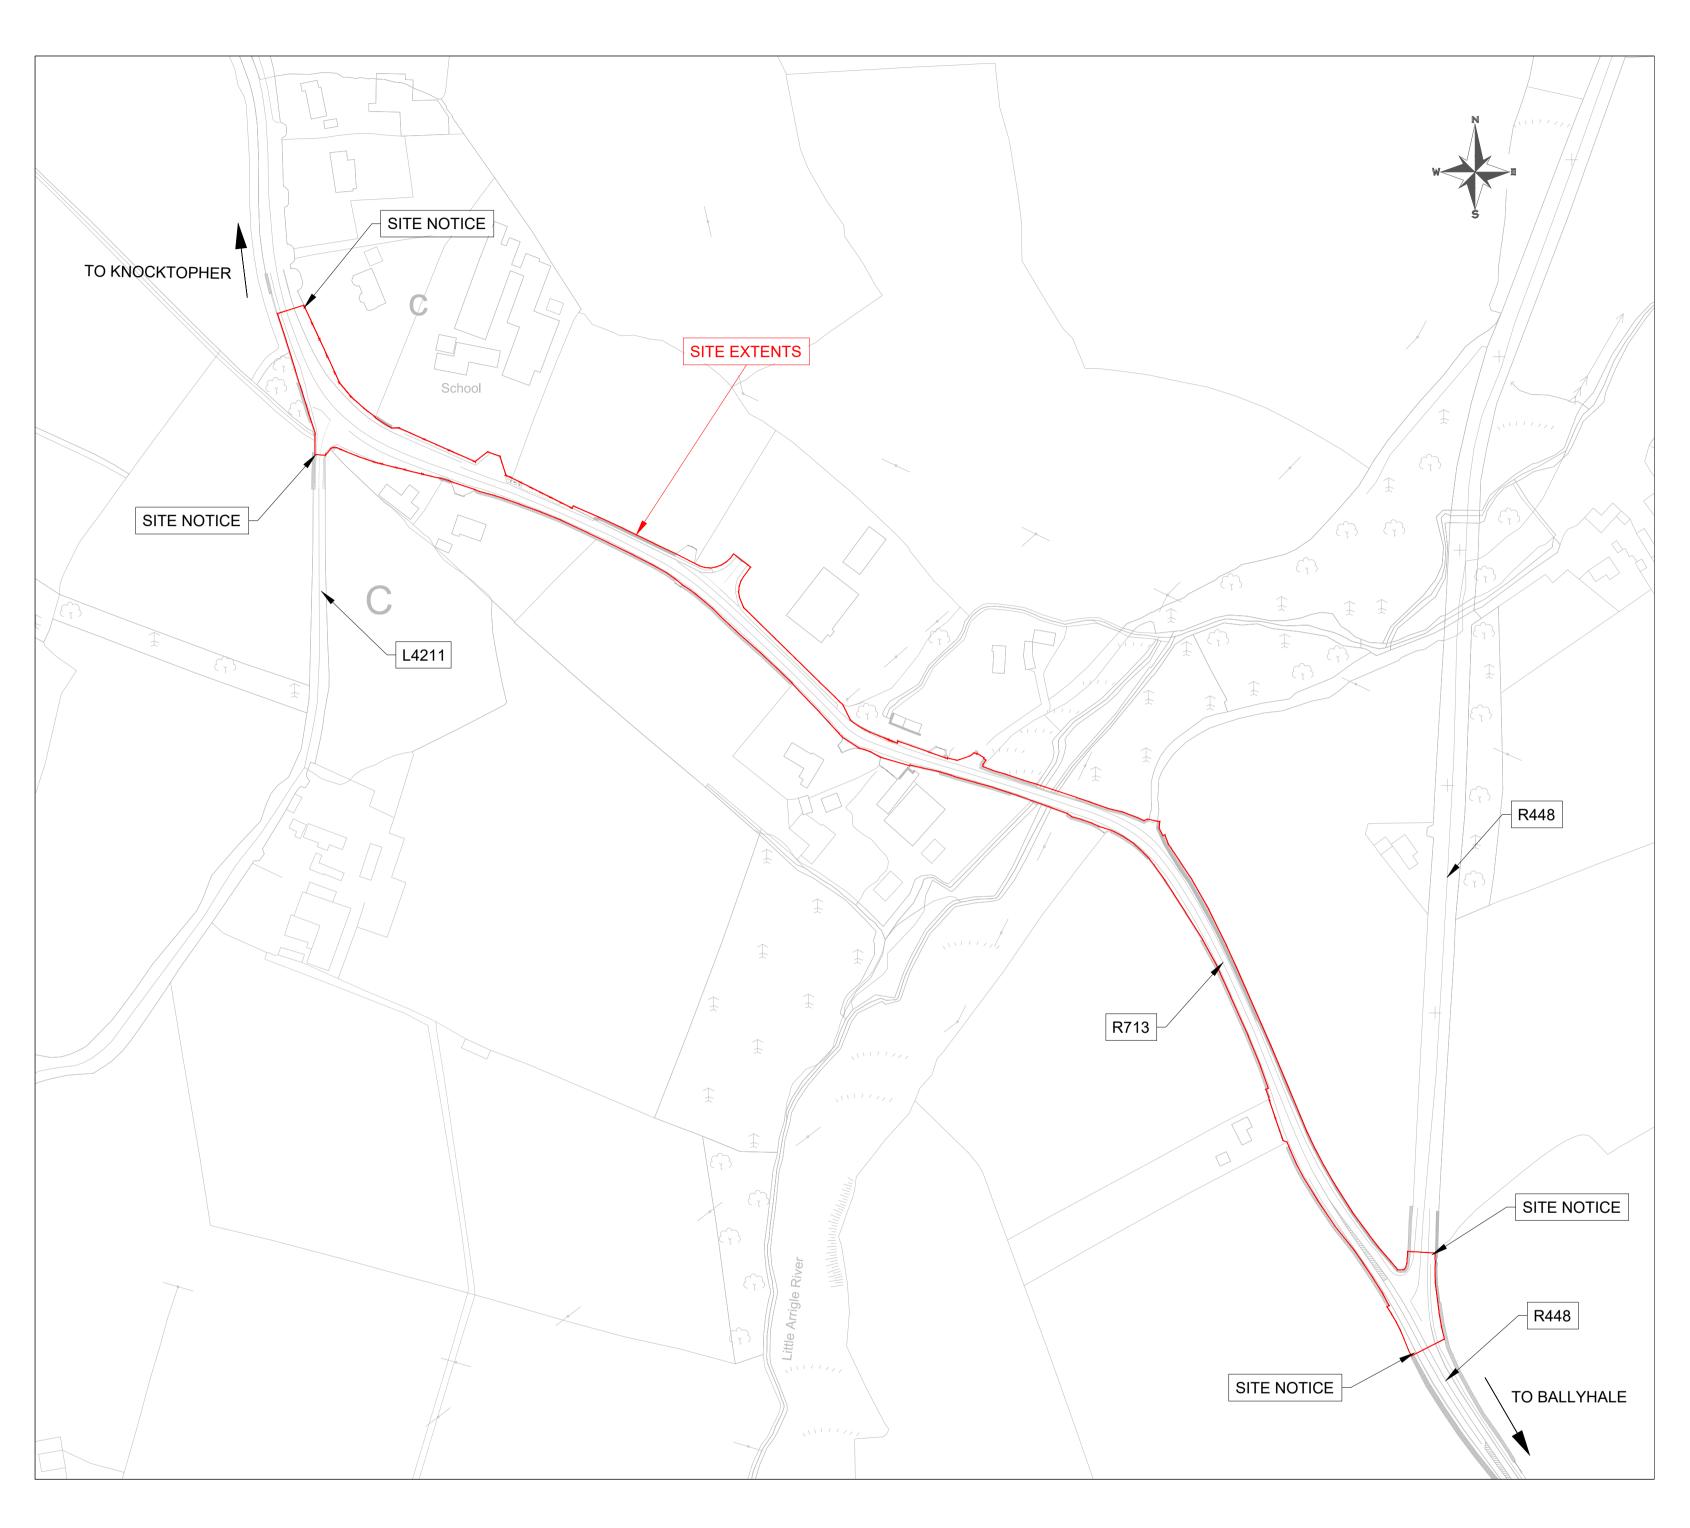

LOCATION MAP SCALE 1:200

© Ordnance Survey Ireland. All rights reserved. Licence number 2019/27/CCMA/KilkennyCountyCouncil








7 Ormonde Road, Kilkenny Tel +353(0)567795800 e-mail: info@roadplan.ie LEGEND

SITE BOUNDARY

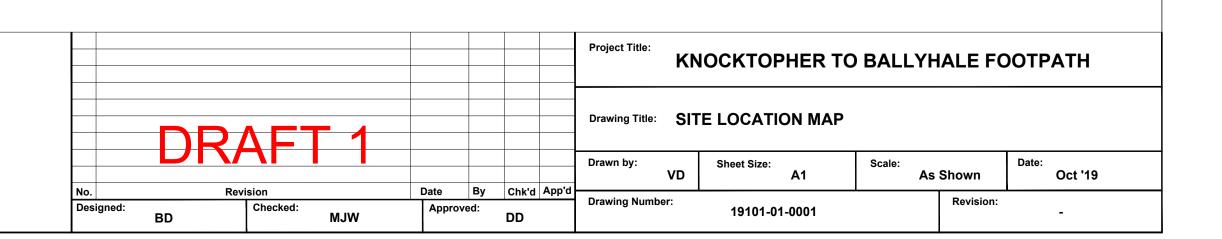

SAFETY AUDIT FEEDBACK FORM

Scheme: Knoctopher to Ballyhale Footpath Scheme

Document Number: 19101-02-001

Audit Stage: Stage 1 RSA

Date Audit Completed: 29th November 2019

Paragraph		To Be Completed by Audit Team Leader			
No. in Safety Audit Report	Problem accepted (yes/no) Recommend measure accepted (yes/no)		Describe alternative measure(s). Give reasons for not accepting recommended measure. Only complete if recommended measure is not accepted.	Alternative measures or reasons accepted by auditors (yes/no)	
2.1	Yes	Yes			
2.2	Yes	Yes		-	
2.3	Yes	Yes		-	
2.4	Yes	Yes	v		
2.5	Yes	Yes		-	
2.6	Yes	Yes	-		
2.7	Yes	Yes	-		
2.8	Yes	Yes			

Sat	at	v	Δı	ıdi	٠
ou.	-	7	~	rui	•

Signed off Michael John Walsh

Design Team Leader

Print Name MICHAEL-JOHN WALSH

Employer

Print Name

Safety Audit Signed off

Safety Audit

Signed off

..... Audit Team Leader

Print Name RAY BATLER.

Date 2/12/19

Date 02/12/19

Please complete and return to: Ray Butler Consultant

55 Barraglas,

Tramore, Co. Waterford E-mail: raybut51@gmail.com